

# nPM1100

## Revision 2

**Errata**

v1.2

# Contents

<b>1</b>	<b>nPM1100 Revision 2 Errata</b> . . . . .	<b>3</b>
<b>2</b>	<b>Revision history</b> . . . . .	<b>4</b>
<b>3</b>	<b>New and inherited anomalies</b> . . . . .	<b>5</b>
	3.1 [4] BUCK, SYSREG: Inserting USB causes VSYS voltage to undershoot . . . . .	5
	3.2 [7] Charger: CHARGER gets stuck with no VBAT capacitor . . . . .	5
	3.3 [8] Charger: CHARGER gets stuck for certain types of PCM . . . . .	6
<b>4</b>	<b>Fixed anomalies</b> . . . . .	<b>7</b>

# 1 nPM1100 Revision 2 Errata

This Errata document contains anomalies and configurations for the nPM1100 chip, revision Revision 2 (CAAA-E00).

The document indicates which anomalies are fixed, inherited, or new compared to revision [Revision 1](#).

## 2 Revision history

See the following list for an overview of changes from previous versions of this document.

Version	Date	Change
nPM1100 Revision 2 v1.2	25.10.2022	<ul style="list-style-type: none"><li>• Edited: No. 7. "CHARGER gets stuck with no VBAT capacitor"</li></ul>
nPM1100 Revision 2 v1.1	08.09.2022	<ul style="list-style-type: none"><li>• Added: No. 7. "CHARGER gets stuck with no VBAT capacitor"</li><li>• Added: No. 8. "CHARGER gets stuck for certain types of PCM"</li></ul>
nPM1100 Revision 2 v1.0	31.05.2022	<ul style="list-style-type: none"><li>• Added: No. 4. "Inserting USB causes VSYS voltage to undershoot"</li></ul>

# 3 New and inherited anomalies

The following anomalies are present in revision Revision 2 of the nPM1100 chip.

ID	Module	Description	Inherited from Revision 1
4	BUCK, SYSREG	Inserting USB causes VSYS voltage to undershoot	X
7	Charger	CHARGER gets stuck with no VBAT capacitor	X
8	Charger	CHARGER gets stuck for certain types of PCM	X

Table 1: New and inherited anomalies

## 3.1 [4] BUCK, SYSREG: Inserting USB causes VSYS voltage to undershoot

This anomaly applies to IC Rev. Revision 2, build codes CAAA-E00.

It was inherited from the previous IC revision [Revision 1](#).

### Symptoms

Inserting USB causes VSYS voltage to undershoot and BUCK converter to reset.

### Conditions

USB power source has slow VBUS rise time in the range of 1 V/ms, battery voltage is below 3.1 V, and system load is higher than 370 mA.

### Consequences

BUCK converter resets.

### Workaround

If the system cannot tolerate a reset, avoid operating under the described conditions.

## 3.2 [7] Charger: CHARGER gets stuck with no VBAT capacitor

This anomaly applies to IC Rev. Revision 2, build codes CAAA-E00.

It was inherited from the previous IC revision [Revision 1](#).

### Symptoms

Battery stops charging, and CHARGER gets stuck in error state.

## Conditions

Battery pack's overdischarge protection is active when VBUS gets connected to a power source.

## Consequences

Charging does not start, and CHARGER gets stuck in error state.

## Workaround

Add a 1.0  $\mu\text{F}$  capacitor to the VBAT pin as shown in the reference circuit in nPM1100 Product Specification v1.2 or later.

## 3.3 [8] Charger: CHARGER gets stuck for certain types of PCM

This anomaly applies to IC Rev. Revision 2, build codes CAAA-E00.

It was inherited from the previous IC revision [Revision 1](#).

## Symptoms

Battery stops charging, and CHARGER gets stuck in error state.

## Conditions

VBAT voltage drops from above  $V_{\text{TRICKLEFAST}}$  to below  $V_{\text{TRICKLEFAST}}$  during charging.

Some battery Protection Circuit Modules (PCM) add a diode junction between the external battery terminals and the lithium cell when the overdischarge protection is active. This diode adds a voltage to the battery terminals during charging. When the protection is released, the diode junction is bypassed and the VBAT voltage drops.

## Consequences

Charging stops when overdischarge protection is released, and the charging cannot be restarted.

## Workaround

Use a battery with a PCM that does not cause this drop when overdischarge protection is released. Alternatively, use a battery with a PCM that drops to a voltage that is higher than  $V_{\text{TRICKLEFAST}}$  or drops from a voltage that is lower than  $V_{\text{TRICKLEFAST}}$ .

# 4 Fixed anomalies

The anomalies listed in this table are no longer present in the current chip version.

For a detailed description of the fixed anomalies, see the [Errata for revision Revision 1](#).

ID	Module	Description
5	BUCK	VOUTB voltage overshoots during mode change through MODE pin
6	BUCK	BUCK converter shuts off unexpectedly

*Table 2: Fixed anomalies*