nRF52840 Engineering B

Errata v1.3



Contents

1	nRF52840 Engineering B Errata	3
2	Change log	4
3	New and inherited anomalies.	6
	 3.1 [20] RTC: Register values are invalid . 3.2 [36] CLOCK: Some registers are not reset when expected . 3.3 [55] I2S: RXPTRUPD and TXPTRUPD events asserted after STOP . 3.4 [66] TEMP: Linearity specification not met with default settings . 3.5 [78] TIMER: High current consumption when using timer STOP task only . 3.6 [81] GPIO: PIN_CNF is not retained when in debug interface mode . 3.7 [87] CPU: Unexpected wake from System ON Idle when using FPU . 3.8 [94] USBD: BUSSTATE register is not functional . 3.9 [122] QSPI: QSPI uses current after being disabled . 3.10 [136] System: Bits in RESETREAS are set when they should not be . 3.11 [153] RADIO: RSSI parameter adjustment . 3.12 [155] GPIOTE: IN event may occur more than once on input edge . 3.13 [166] USBD: ISO double buffering not functional . 3.14 [170] I2S: NRF_I2S->PSEL CONNECT fields are not readable . 3.15 [171] USB,USBD: USB might not power up . 3.16 [173] GPIO: Writes to LATCH register take several CPU cycles to take effect . 3.17 [174] SPIM: SPIM3 events incorrectly connected to the PPI . 3.18 [176] System: Flash erase through CTRL-AP fails due to watchdog time-out . 3.19 [179] RTC: COMPARE event is generated twice from a single RTC compare match . 3.20 [183] PWM: False SEOEND[1] avents . 	7 8 9 10 10 10 11 11 12 13 13 14 14 15 16 17 17
	 3.21 [184] NVMC: Erase or write operations from the external debugger fail when CPU is not halted 3.22 [186] POWER: High current consumption in System ON Idle, using High Voltage mode . 3.23 [187] USBD: USB cannot be enabled . 3.24 [189] SPIM: RX buffer error at 32 MHz operation . 3.25 [190] NFCT: Event FIELDDETECTED may be generated too early . 3.26 [191] RADIO: High packet error rate in BLE Long Range mode . 3.27 [192] CLOCK: LFRC frequency offset after calibration . 3.28 [193] SPIM: SPIM3 does not generate EVENTS_END and halts if suspended during last byte . 3.29 [194] I2S: STOP task does not switch off all resources . 3.30 [195] SPIM: SPIM3 continues to draw current after disable . 3.31 [196] I2S: PSEL acquires GPIOs regardless of ENABLE . 3.32 [198] nRF52840: SPIM3 transmit data might be corrupted . 3.34 [202] POWER: Device does not start up in high voltage mode . 	 18 19 20 21 22 23 24 24 25
4	Fixed anomalies	27



1 nRF52840 Engineering B Errata

This Errata document contains anomalies for the nRF52840 chip, revision Engineering B (QIAA-BAO, QIAA-BBO, CKAA-AAO).

The document indicates which anomalies are fixed, inherited, or new compared to revision Engineering A nRF52840.



2 Change log

See the following list for an overview of changes from previous versions of this document.

Version	Date	Change
nRF52840 Engineering B v1.3	30.05.2018	• Updated: No. 202. "Device does not start up in high voltage mode"
nRF52840 Engineering B v1.2	23.03.2018	 Updated: No. 171. "USB might not power up" Added: No. 122. "QSPI uses current after being disabled" Added: No. 190. "Event FIELDDETECTED may be generated too early" Added: No. 192. "LFRC frequency offset after calibration" Added: No. 194. "STOP task does not switch off all resources" Added: No. 195. "SPIM3 continues to draw current after disable" Added: No. 196. "PSEL acquires GPIOs regardless of ENABLE" Added: No. 198. "SPIM3 transmit data might be corrupted" Added: No. 201. "EVENTS_HFCLKSTARTED might be generated twice" Added: No. 202. "Device does not start up in high voltage mode"
nRF52840 Engineering B v1.1	09.02.2018	 Updated: No. 171. "USB might not power up" Added: No. 189. "RX buffer error at 32 MHz operation" Added: No. 191. "High packet error rate in BLE Long Range mode" Added: No. 193. "SPIM3 does not generate EVENTS_END and halts if suspended during last byte"



Version	Date	Change
nRF52840 Engineering B v1.0	13.11.2017	 Added: No. 20. "Register values are invalid" Added: No. 36. "Some registers are not reset when expected" Added: No. 55. "RXPTRUPD and TXPTRUPD events asserted after STOP" Added: No. 66. "Linearity specification not met with default settings" Added: No. 78. "High current consumption when using timer STOP task only" Added: No. 81. "PIN_CNF is not retained when in debug interface mode" Added: No. 87. "Unexpected wake from System ON Idle when using FPU" Added: No. 87. "Unexpected wake from System ON Idle when using FPU" Added: No. 94. "BUSSTATE register is not functional" Added: No. 136. "Bits in RESETREAS are set when they should not be" Added: No. 155. "IN event may occur more than once on input edge" Added: No. 166. "ISO double buffering not functional" Added: No. 170. "NRF_I2S->PSEL CONNECT fields are not readable" Added: No. 171. "USB might not power up" Added: No. 173. "Writes to LATCH register take several CPU cycles to take effect" Added: No. 174. "SPIM3 events incorrectly connected to the PPI" Added: No. 179. "COMPARE event is generated twice from a single RTC compare match" Added: No. 183. "False SEQEND[0] and SEQEND[1] events" Added: No. 184. "Erase or write operations from the external debugger fail when CPU is not halted" Added: No. 186. " High current consumption in System ON Idle, using High Voltage mode" Added: No. 187. "USB cannot be enabled"



3 New and inherited anomalies

The following anomalies are present in revision Engineering B of the nRF52840 chip.

ID	Module	Description	New in Engineering B	Inherited from Engineering A nRE52840
20	RTC	Register values are invalid		X
36	CLOCK	Some registers are not reset when expected		Х
55	125	RXPTRUPD and TXPTRUPD events asserted after STOP		X
66	TEMP	Linearity specification not met with default settings		Х
78	TIMER	High current consumption when using timer STOP task only		x
81	GPIO	PIN_CNF is not retained when in debug interface mode		Х
87	CPU	Unexpected wake from System ON Idle when using FPU		х
94	USBD	BUSSTATE register is not functional		х
122	QSPI	QSPI uses current after being disabled		х
136	System	Bits in RESETREAS are set when they should not be		х
153	RADIO	RSSI parameter adjustment		х
155	GPIOTE	IN event may occur more than once on input edge		Х
166	USBD	ISO double buffering not functional		Х
170	125	NRF_I2S->PSEL CONNECT fields are not readable		Х
171	USB,USBD	USB might not power up		Х
173	GPIO	Writes to LATCH register take several CPU cycles to take effect		х
174	SPIM	SPIM3 events incorrectly connected to the PPI	Х	
176	System	Flash erase through CTRL-AP fails due to watchdog time- out		х
179	RTC	COMPARE event is generated twice from a single RTC compare match		Х
183	PWM	False SEQEND[0] and SEQEND[1] events		Х
184	NVMC	Erase or write operations from the external debugger fail when CPU is not halted		Х
186	POWER	High current consumption in System ON Idle, using High Voltage mode	Х	
187	USBD	USB cannot be enabled	Х	



ID	Module	Description	New in Engineering B	Inherited from Engineering A nRF52840
189	SPIM	RX buffer error at 32 MHz operation	Х	
190	NFCT	Event FIELDDETECTED may be generated too early	Х	
191	RADIO	High packet error rate in BLE Long Range mode	Х	
192	CLOCK	LFRC frequency offset after calibration		Х
193	SPIM	SPIM3 does not generate EVENTS_END and halts if suspended during last byte	х	
194	125	STOP task does not switch off all resources		Х
195	SPIM	SPIM3 continues to draw current after disable	Х	
196	125	PSEL acquires GPIOs regardless of ENABLE		Х
198	nRF52840	SPIM3 transmit data might be corrupted	Х	
201	CLOCK	EVENTS_HFCLKSTARTED might be generated twice		Х
202	POWER	Device does not start up in high voltage mode	X	

Table 1: New and inherited anomalies

3.1 [20] RTC: Register values are invalid

This anomaly applies to IC Rev. Engineering B, build codes QIAA-BAO, QIAA-BBO, CKAA-AAO. It was inherited from the previous IC revision Engineering A nRF52840.

Symptoms

RTC registers will not contain the correct/expected value if read.

Conditions

The RTC has been idle.

Consequences

RTC configuration cannot be determined by reading RTC registers.

Workaround

Execute the below code before you use RTC.

```
NRF_CLOCK->EVENTS_LFCLKSTARTED = 0;
NRF_CLOCK->TASKS_LFCLKSTART = 1;
while (NRF_CLOCK->EVENTS_LFCLKSTARTED == 0) {}
NRF RTC0->TASKS STOP = 0;
```



3.2 [36] CLOCK: Some registers are not reset when expected

This anomaly applies to IC Rev. Engineering B, build codes QIAA-BAO, QIAA-BBO, CKAA-AAO.

It was inherited from the previous IC revision Engineering A nRF52840.

Symptoms

After watchdog timeout reset, CPU lockup reset, soft reset, or pin reset, the following CLOCK peripheral registers are not reset:

- CLOCK->EVENTS_DONE
- CLOCK->EVENTS_CTTO
- CLOCK->CTIV

Conditions

After watchdog timeout reset, CPU Lockup reset, soft reset, and pin reset.

Consequences

Register reset values might be incorrect. It may cause undesired interrupts in case of enabling interrupts without clearing the DONE or CTTO events.

Workaround

Clear affected registers after reset. This workaround has already been added into system_nrf52.c file. This workaround has already been added into system_nrf52840.c file present in MDK 8.11.0 or later.

3.3 [55] I2S: RXPTRUPD and TXPTRUPD events asserted after STOP

This anomaly applies to IC Rev. Engineering B, build codes QIAA-BAO, QIAA-BBO, CKAA-AAO.

It was inherited from the previous IC revision Engineering A nRF52840.

Symptoms

The RXPTRUPD event is generated when the STOP task is triggered, even though reception (RX) is disabled. Similarly, the TXPTRUPD event is generated when the STOP task is triggered, even though transmission (TX) is disabled.

Conditions

A previous transfer has been performed with RX/TX enabled, respectively.

Consequences

The indication that RXTXD.MAXCNT words were received/transmitted is false.



Workaround

Ignore the RXPTRUPD and TXPTRUPD events after triggering the STOP task. Clear these events before starting the next transfer.

3.4 [66] TEMP: Linearity specification not met with default settings

This anomaly applies to IC Rev. Engineering B, build codes QIAA-BAO, QIAA-BBO, CKAA-AAO. It was inherited from the previous IC revision Engineering A nRF52840.

Symptoms

TEMP module provides non-linear temperature readings over the specified temperature range.

Conditions

Always.

Consequences

TEMP module returns out of spec temperature readings.

Workaround

Execute the following code after reset:

```
NRF TEMP->A0 = NRF FICR->TEMP.A0;
NRF TEMP->A1 = NRF FICR->TEMP.A1;
NRF_TEMP->A2 = NRF_FICR->TEMP.A2;
NRF_TEMP->A3 = NRF_FICR->TEMP.A3;
NRF TEMP->A4 = NRF_FICR->TEMP.A4;
NRF TEMP->A5 = NRF FICR->TEMP.A5;
NRF TEMP->B0 = NRF FICR->TEMP.B0;
NRF TEMP->B1 = NRF FICR->TEMP.B1;
NRF TEMP->B2 = NRF FICR->TEMP.B2;
NRF_TEMP->B3 = NRF_FICR->TEMP.B3;
NRF TEMP->B4 = NRF FICR->TEMP.B4;
NRF TEMP->B5 = NRF FICR->TEMP.B5;
NRF_TEMP->TO = NRF_FICR->TEMP.TO;
NRF TEMP->T1 = NRF FICR->TEMP.T1;
NRF TEMP->T2 = NRF FICR->TEMP.T2;
NRF TEMP->T3 = NRF FICR->TEMP.T3;
NRF TEMP->T4 = NRF FICR->TEMP.T4;
```

This code is already present in the latest system_nrf52.c file and in the system_nrf52840.c file released in MDK 8.12.0.



3.5 [78] TIMER: High current consumption when using timer STOP task only

This anomaly applies to IC Rev. Engineering B, build codes QIAA-BAO, QIAA-BBO, CKAA-AAO. It was inherited from the previous IC revision Engineering A nRF52840.

Symptoms

Increased current consumption when the timer has been running and the STOP task is used to stop it.

Conditions

The timer has been running (after triggering a START task) and then it is stopped using a STOP task only.

Consequences

Increased current consumption.

Workaround

Use the SHUTDOWN task after the STOP task or instead of the STOP task.

3.6 [81] GPIO: PIN_CNF is not retained when in debug interface mode

This anomaly applies to IC Rev. Engineering B, build codes QIAA-BAO, QIAA-BBO, CKAA-AAO. It was inherited from the previous IC revision Engineering A nRF52840.

Symptoms

GPIO pin configuration is reset on wakeup from System OFF.

Conditions

The system is in debug interface mode.

Consequences

GPIO state unreliable until PIN_CNF is reconfigured.

3.7 [87] CPU: Unexpected wake from System ON Idle when using FPU

This anomaly applies to IC Rev. Engineering B, build codes QIAA-BAO, QIAA-BBO, CKAA-AAO. It was inherited from the previous IC revision Engineering A nRF52840.



Symptoms

The CPU is unexpectedly awoken from System ON Idle.

Conditions

The FPU has been used.

Consequences

The CPU is awoken from System ON Idle.

Workaround

The FPU can generate pending interrupts just like other peripherals, but unlike other peripherals there are no INTENSET, INTENCLR registers for enabling or disabling interrupts at the peripheral level. In order to prevent unexpected wake-up from System ON Idle, add this code before entering sleep:

```
#if (__FPU_USED == 1)
    _set_FPSCR(_get_FPSCR() & ~(0x0000009F));
  (void) __get_FPSCR();
  NVIC_ClearPendingIRQ(FPU_IRQn);
#endif
    __WFE();
```

3.8 [94] USBD: BUSSTATE register is not functional

This anomaly applies to IC Rev. Engineering B, build codes QIAA-BAO, QIAA-BBO, CKAA-AAO.

It was inherited from the previous IC revision Engineering A nRF52840.

Symptoms

BUSSTATE register is not functional.

Conditions

Always.

Consequences

Reading BUSSTATE will not show the state of the bus as documented. No impact on USB 2.0 compliance.

Workaround

None.

3.9 [122] QSPI: QSPI uses current after being disabled

This anomaly applies to IC Rev. Engineering B, build codes QIAA-BAO, QIAA-BBO, CKAA-AAO. It was inherited from the previous IC revision Engineering A nRF52840.



Symptoms

Current consumption is too high.

Conditions

After QSPI has been activated by the use of TASKS_ACTIVATE task.

Consequences

Current consumption is too high.

Workaround

Execute the following code before disabling QSPI:

```
*(volatile uint32_t *)0x40029010ul = 1ul;
*(volatile uint32 t *)0x40029054ul = 1ul
```

3.10 [136] System: Bits in RESETREAS are set when they should not be

This anomaly applies to IC Rev. Engineering B, build codes QIAA-BAO, QIAA-BBO, CKAA-AAO.

It was inherited from the previous IC revision Engineering A nRF52840.

Symptoms

After pin reset, RESETREAS bits other than RESETPIN might also be set.

Conditions

A pin reset has triggered.

Consequences

If the firmware evaluates RESETREAS, it might take the wrong action.

Workaround

When RESETREAS shows a pin reset (RESETPIN), ignore other reset reason bits.

Important: RESETREAS bits must be cleared between resets.

Apply the following code after any reset:

```
if (NRF_POWER->RESETREAS & POWER_RESETREAS_RESETPIN_Msk) {
    NRF_POWER->RESETREAS = ~POWER_RESETREAS_RESETPIN_Msk;
}
```

This workaround is implemented in MDK version 8.13.0 and later.



3.11 [153] RADIO: RSSI parameter adjustment

This anomaly applies to IC Rev. Engineering B, build codes QIAA-BAO, QIAA-BBO, CKAA-AAO.

It was inherited from the previous IC revision Engineering A nRF52840.

Symptoms

RSSI changes over temperature.

Conditions

Temperature \leq +10°C or > +30°C.

Consequences

RSSI parameter not within specified accuracy.

Workaround

Add the following compensation to the RSSI sample value based on temperature measurement (the onchip TEMP peripheral can be used to measure temperature):

- For TEMP ≤ -30°C, RSSISAMPLE = RSSISAMPLE +3
- For TEMP > -30°C and TEMP ≤ -10°C, RSSISAMPLE = RSSISAMPLE +2
- For TEMP > -10°C and TEMP ≤ +10°C, RSSISAMPLE = RSSISAMPLE +1
- For TEMP > +10°C and TEMP ≤ +30°C, RSSISAMPLE = RSSISAMPLE + 0
- For TEMP > +30°C and TEMP ≤ +50°C, RSSISAMPLE = RSSISAMPLE 1
- For TEMP > +50°C and TEMP ≤ +70°C, RSSISAMPLE = RSSISAMPLE 2
- For TEMP > +70°C, RSSISAMPLE = RSSISAMPLE 3

3.12 [155] GPIOTE: IN event may occur more than once on input edge

This anomaly applies to IC Rev. Engineering B, build codes QIAA-BAO, QIAA-BBO, CKAA-AAO.

It was inherited from the previous IC revision Engineering A nRF52840.

Symptoms

IN event occurs more than once on an input edge.

Conditions

Input signal edges are closer together than 1.3 μ s or >= 750 kHz for a periodic signal.

Consequences

Tasks connected through PPI or SHORTS to this event might be triggered twice.



Workaround

Apply the following code when any GPIOTE channel is configured to generate an IN event on edges that can occur within 1.3 μ s of each other:

```
*(volatile uint32_t *)(NRF_GPIOTE_BASE + 0x600 + (4 * GPIOTE_CH_USED)) = 1;
```

Important: A clock is kept on by the workaround and must be reverted to avoid higher current consumption when GPIOTE is not in use, using the following code:

```
*(volatile uint32_t *)(NRF_GPIOTE_BASE + 0x600 + (4 * GPIOTE_CH_USED)) = 0;
```

3.13 [166] USBD: ISO double buffering not functional

This anomaly applies to IC Rev. Engineering B, build codes QIAA-BAO, QIAA-BBO, CKAA-AAO.

It was inherited from the previous IC revision Engineering A nRF52840.

Symptoms

The double buffering of the ISO EPs of the USBD is not functional.

Conditions

Always. With default settings, the buffers overlap.

Consequences

During ISO transition, received or transmitted data is likely to be corrupted.

Workaround

Reconfigure ISO buffers during initialization of USBD. After each time the USBD peripheral is enabled, apply the following code:

```
*((volatile uint32_t *)(NRF_USBD_BASE + 0x800)) = 0x7E3;
*((volatile uint32_t *)(NRF_USBD_BASE + 0x804)) = 0x40;
```

3.14 [170] I2S: NRF_I2S->PSEL CONNECT fields are not readable

This anomaly applies to IC Rev. Engineering B, build codes QIAA-BAO, QIAA-BBO, CKAA-AAO.

It was inherited from the previous IC revision Engineering A nRF52840.

Symptoms

- CONNECT field of NRF_I2S->PSEL.MCK is not readable.
- CONNECT field of NRF_I2S->PSEL.SCK is not readable.



- CONNECT field of NRF_I2S->PSEL.LRCK is not readable.
- CONNECT field of NRF_I2S->PSEL.SDIN is not readable.
- CONNECT field of NRF_I2S->PSEL.SDOUT is not readable.

Conditions

Always.

Consequences

When reading the value of NRF_I2S->PSEL registers, the CONNECT field might not return the same value that has been written to it.

Workaround

None.

3.15 [171] USB, USBD: USB might not power up

This anomaly applies to IC Rev. Engineering B, build codes QIAA-BAO, QIAA-BBO, CKAA-AAO.

It was inherited from the previous IC revision Engineering A nRF52840.

Symptoms

The USBD might not reach its active state. It is also possible that the USBD reaches its active state, but with an increased delay.

Conditions

Firmware enables USBD or exits USBD low power mode (clears USBD->LOWPOWER) and enters System ON IDLE before the USBD module is fully powered up.

Consequences

The USBD sometimes does not function.

Workaround

To enable the USBD (USBD.ENABLE = 1) or to wake the USBD during SUSPEND (USBD.LOWPOWER = 0), apply the following code:

```
if(*(volatile uint32_t *)0x4006EC00 == 0x00000000)
{
    *(volatile uint32_t *)0x4006EC00 = 0x00009375;
}
*(volatile uint32_t *)0x4006EC14 = 0x000000C0;
*(volatile uint32_t *)0x4006EC00 = 0x00009375;
NRF_USBD->ENABLE = 0x0000001; // or NRF_USBD->LOWPOWER = 0x0000000;
```



After receiving the corresponding acknowledgment event (i.e. USBD.EVENTS_USBEVENT with USBD.EVENTCAUSE.READY=1 in case of enabling or USBD->EVENTCAUSE.USBWUALLOWED=1 in case of wakeup), apply the following code:

```
if(*(volatile uint32_t *)0x4006EC00 == 0x0000000)
{
    *(volatile uint32_t *)0x4006EC00 = 0x00009375;
}
*(volatile uint32_t *)0x4006EC14 = 0x00000000;
*(volatile uint32_t *)0x4006EC00 = 0x00009375;
```

3.16 [173] GPIO: Writes to LATCH register take several CPU cycles to take effect

This anomaly applies to IC Rev. Engineering B, build codes QIAA-BAO, QIAA-BBO, CKAA-AAO.

It was inherited from the previous IC revision Engineering A nRF52840.

Symptoms

A bit in the LATCH register reads '1' even after clearing it by writing '1'.

Conditions

Reading the LATCH register right after writing to it.

Consequences

Old value of the LATCH register is read.

Workaround

Have at least 3 CPU cycles of delay between the write and the subsequent read to the LATCH register. This can be achieved by having 3 dummy reads to the LATCH register.

3.17 [174] SPIM: SPIM3 events incorrectly connected to the PPI

This anomaly applies to IC Rev. Engineering B, build codes QIAA-BAO, QIAA-BBO, CKAA-AAO.

Symptoms

Tasks triggered from the PPI using EVENTS_ENDRX or EVENTS_ENDTX of SPIM3 do not happen when expected.

Conditions

Always.



Consequences

EVENTS_ENDRX and EVENTS_ENDTX of SPIM3 have their connections to the PPI swapped. Tasks triggered by the PPI from EVENTS_ENDRX or EVENTS_ENDTX of SPIM3 do not happen when expected.

Workaround

When configuring the PPI to trigger a task on EVENTS_ENDRX, program the CH[N].EEP register with the address of EVENTS_ENDTX. When configuring the PPI to trigger a task on EVENTS_ENDTX, program the CH[N].EEP register with the address of EVENTS_ENDRX.

This only applies to the SPIM3 instance.

3.18 [176] System: Flash erase through CTRL-AP fails due to watchdog time-out

This anomaly applies to IC Rev. Engineering B, build codes QIAA-BAO, QIAA-BBO, CKAA-AAO.

It was inherited from the previous IC revision Engineering A nRF52840.

Symptoms

Full flash erase through CTRL-AP is not successful.

Conditions

WDT is enabled.

Consequences

Flash is not erased. If the device has a WDT time-out less than 1 ms and is readback-protected through UICR.APPROTECT, there is a risk of permanently preventing the erasing of the flash.

Workaround

Try again.

3.19 [179] RTC: COMPARE event is generated twice from a single RTC compare match

This anomaly applies to IC Rev. Engineering B, build codes QIAA-BAO, QIAA-BBO, CKAA-AAO.

It was inherited from the previous IC revision Engineering A nRF52840.

Symptoms

Tasks connected to RTC COMPARE event through PPI are triggered twice per compare match.

Conditions

RTC registers are being accessed by CPU while RTC is running.



Consequences

Tasks connected to RTC COMPARE event through PPI are triggered more often than expected.

Workaround

Do not access the RTC registers, including the COMPARE event register, from CPU while waiting for the RTC COMPARE event. Note that CPU interrupt from this event can still be enabled.

3.20 [183] PWM: False SEQEND[0] and SEQEND[1] events

This anomaly applies to IC Rev. Engineering B, build codes QIAA-BAO, QIAA-BBO, CKAA-AAO.

It was inherited from the previous IC revision Engineering A nRF52840.

Symptoms

False SEQEND[0] and SEQEND[1] events are being generated.

Conditions

Any of the LOOPSDONE_SEQSTARTn shortcuts are enabled. LOOP register is non-zero and sequence 1 is one value long.

Consequences

SEQEND[0] and SEQEND[1] events might falsely trigger other tasks if these are routed through the PPI.

Workaround

Avoid using the LOOPSDONE_SEQSTARTn shortcuts, when LOOP register is non-zero and sequence 1 is one value long.

3.21 [184] NVMC: Erase or write operations from the external debugger fail when CPU is not halted

This anomaly applies to IC Rev. Engineering B, build codes QIAA-BAO, QIAA-BBO, CKAA-AAO.

It was inherited from the previous IC revision Engineering A nRF52840.

Symptoms

The erase or write operation fails or takes longer time than specified.

Conditions

NVMC erase or write operation initiated using an external debugger. CPU is not halted.

Consequences

The NVMC erase or write operation fails or takes longer time than specified.



Workaround

Halt the CPU by writing to DHCSR (Debug Halting Control and Status Register) before starting NVMC erase or write operation from the external debugger. See the ARM infocenter to get the details of the DHCSR register.

Programming tools provided by Nordic Semiconductor comply with this.

3.22 [186] POWER: High current consumption in System ON Idle, using High Voltage mode

This anomaly applies to IC Rev. Engineering B, build codes QIAA-BAO, QIAA-BBO, CKAA-AAO.

Symptoms

High current consumption in System ON Idle

Conditions

When using High Voltage mode (supply connected to VDDH).

Consequences

Increased current counsumption in System On Idle.

Workaround

None.

3.23 [187] USBD: USB cannot be enabled

This anomaly applies to IC Rev. Engineering B, build codes QIAA-BAO, QIAA-BBO, CKAA-AAO.

Symptoms

After writing to NRF_USBD->ENABLE, no EVENTS_USBEVENT is triggered, and USB->EVENTCAUSE is not updated.

Conditions

Most recent reset type is soft reset or CPU lockup reset, or after a new firmware update to flash.

Consequences

USB is not working.



Workaround

Implement code similar to the following around the USB enabling:

```
* (volatile uint32_t *)0x4006EC00 = 0x00009375;
* (volatile uint32_t *)0x4006ED14 = 0x0000003;
* (volatile uint32_t *)0x4006EC00 = 0x00009375;
/* Enable the peripheral */
NRF_USBD->ENABLE = USBD_ENABLE_ENABLE_Enabled<< USBD_ENABLE_ENABLE_Pos;
/* Waiting for peripheral to enable, this should take a few µs */
while (0 == (NRF_USBD->EVENTCAUSE & USBD_EVENTCAUSE_READY_Msk))
{
    /* Empty loop */
}
NRF_USBD->EVENTCAUSE &= ~USBD_EVENTCAUSE_READY_Msk;
* (volatile uint32_t *)0x4006EC00 = 0x00009375;
* (volatile uint32_t *)0x4006ED14 = 0x0000000;
* (volatile uint32_t *)0x4006EC00 = 0x00009375;
```

nRF5 SDK version 15 will include this workaround.

3.24 [189] SPIM: RX buffer error at 32 MHz operation

This anomaly applies to IC Rev. Engineering B, build codes QIAA-BAO, QIAA-BBO, CKAA-AAO.

Symptoms

The last byte received in the RX buffer is always equal to the value of the second last byte.

Conditions

SPIM3 operating at 32 MHz.

Consequences

SPIM3 not working.

Workaround

If the application allows, use 16 MHz. If the external SPI slave allows, read one additional byte and ignore this last byte.

3.25 [190] NFCT: Event FIELDDETECTED may be generated too early

This anomaly applies to IC Rev. Engineering B, build codes QIAA-BAO, QIAA-BBO, CKAA-AAO.



Symptoms

Reset of the operating state after FIELDLOST event. In some cases, communication with the peer device is not possible.

Conditions

Always. Especially with stronger field strengths.

Consequences

Restart of transfer required.

Workaround

On FIELDDETECTED event, wait 1 ms (using timer) before starting NFC communication with NRF_NFCT->TASKS_ACTIVATE.

This workaround is included in SDK v15.0.0.

3.26 [191] RADIO: High packet error rate in BLE Long Range mode

This anomaly applies to IC Rev. Engineering B, build codes QIAA-BAO, QIAA-BBO, CKAA-AAO.

Symptoms

High packet error rate.

Conditions

BLE Long Range mode.

Consequences

Poor communication link.

Workaround

Use the following setting for the radio in BLE LR mode (set after power-on-reset and whenever NRF_RADIO->POWER has been low):

```
*(volatile uint32_t *) 0x40001740 = ((*((volatile uint32_t *) 0x40001740)) & 0x7FFF00FF) |
0x80000000 | (((uint32_t)(196)) << 8);</pre>
```

When switching from BLE LR mode to any other radio mode, use the following code to return to default settings:

```
*(volatile uint32_t *) 0x40001740 = ((*((volatile uint32_t *) 0x40001740)) & 0x7FFFFFF);
```



3.27 [192] CLOCK: LFRC frequency offset after calibration

This anomaly applies to IC Rev. Engineering B, build codes QIAA-BAO, QIAA-BBO, CKAA-AAO. It was inherited from the previous IC revision Engineering A nRF52840.

Symptoms

LFRC oscillator frequency is wrong after calibration, exceeding 500 ppm.

Conditions

On some devices, when entering System ON Idle while calibration is ongoing.

Consequences

After calibration, LFRC has a frequency offset that is outside specification.

Workaround

Apply the following code before starting the RCOSC32K calibration:

*(volatile uint32_t *)0x40000C34 = 0x0000002;

Apply the following code after the RCOSC32K calibration is finished:

*(volatile uint32 t *)0x40000C34 = 0x0000000;

This workaround is included in SDK v15.0.0 and SoftDevices S140, S132, and S112 v6.0.0.

3.28 [193] SPIM: SPIM3 does not generate EVENTS_END and halts if suspended during last byte

This anomaly applies to IC Rev. Engineering B, build codes QIAA-BAO, CKAA-AAO.

Symptoms

SPIM3 stops working.

Conditions

Using TASKS_SUSPEND on SPIM3 during last byte.

Consequences

EVENTS_END is not generated and SPIM3 stops working.



Workaround

Do not use TASKS_SUSPEND for SPIM3 unless the application can guarantee that it will not be triggered during the transfer of the last byte. There is no indication from SPIM3 that it is currently in the last byte transfer.

If TASKS_SUSPEND was used during transmission of the last byte, recover SPIM3 by power cycling the device or restart SPIM3 using the following code:

```
*(volatile uint32_t *)0x4002FFFC = 0;
*(volatile uint32_t *)0x4002FFFC;
```

```
*(volatile uint32_t *)0x4002FFFC = 1;
```

3.29 [194] I2S: STOP task does not switch off all resources

This anomaly applies to IC Rev. Engineering B, build codes QIAA-BAO, QIAA-BBO, CKAA-AAO.

It was inherited from the previous IC revision Engineering A nRF52840.

Symptoms

Current consumption too high (~900 μ A) after using the STOP task.

Conditions

I2S was running and was stopped by triggering the STOP task.

Consequences

Current consumption higher than specified.

Workaround

Apply the following code after the STOP task:

```
*((volatile uint32_t *)0x40025038) = 1;
*((volatile uint32 t *)0x4002503C) = 1;
```

3.30 [195] SPIM: SPIM3 continues to draw current after disable

This anomaly applies to IC Rev. Engineering B, build codes QIAA-BAO, QIAA-BBO, CKAA-AAO.

Symptoms

Current consumption higher than specified when disabling the SPIM3.



Conditions

When disabling the SPIM3.

Consequences

Current consumption around 900 µA higher than specified.

Workaround

Apply the following workaround after disabling the SPIM3 (NRF SPIM3->ENABLE = 0):

```
*(volatile uint32_t *)0x4002F004 = 1;
```

3.31 [196] I2S: PSEL acquires GPIOs regardless of ENABLE

This anomaly applies to IC Rev. Engineering B, build codes QIAA-BAO, QIAA-BBO, CKAA-AAO. It was inherited from the previous IC revision Engineering A nRF52840.

Symptoms

I2S controls GPIO even when I2S is not enabled.

Conditions

When using I2S->PSEL to configure GPIO.

Consequences

GPIO selected for I2S cannot be used for any other peripheral.

Workaround

Do not rely on the pins selected in I2S->PSEL registers being free when I2S->ENABLE is set to DISABLE.

Only set the CONNECT bit in the I2S->PSEL registers to CONNECTED immediately before enabling I2S. When disabling I2S, set the CONNECT bit in the I2S->PSEL registers to DISCONNECTED.

3.32 [198] nRF52840: SPIM3 transmit data might be corrupted

This anomaly applies to IC Rev. Engineering B, build codes QIAA-BAO, QIAA-BBO, CKAA-AAO.

Symptoms

Transmit data from SPIM3 is corrupted.



Conditions

Data accessed by CPU location in the same RAM block as where the SPIM3 TXD.PTR is pointing, and CPU does a read or write operation at the same clock cycle as the SPIM3 EasyDMA is fetching data.

Consequences

Transmit data from SPIM3 is corrupted.

Workaround

Reserve dedicated RAM blocks for the SPIM3 transmit buffer, not overlapping with application data used by the CPU. In addition, synchronize so that the CPU is not writing data to the transmit buffer while SPIM is transmitting data.

3.33 [201] CLOCK: EVENTS_HFCLKSTARTED might be generated twice

This anomaly applies to IC Rev. Engineering B, build codes QIAA-BBO, CKAA-AAO.

It was inherited from the previous IC revision Engineering A nRF52840.

Symptoms

EVENTS_HFCLKSTARTED might occur twice, and HFCLKSTAT might be wrong.

Conditions

When running HFCLK with crystal.

Consequences

HFCLKSTAT might be wrong when reading it after HFCLK is started.

Workaround

Disregard HFCLKSTAT and EVENT_HFCLKSTARTED after first EVENT_HFCLKSTARTED.

This workaround is included in nRF5 SDK v15.0.0 and SoftDevices S140, S132, and S112 v6.0.0.

3.34 [202] POWER: Device does not start up in high voltage mode

This anomaly applies to IC Rev. Engineering B, build codes QIAA-BAO, QIAA-BBO.

Symptoms

Device does not start up in high voltage mode.

Conditions

Using REG0 and external circuitry supply or slow rise time on VDDH. Power on reset (POR) may not release correctly.



Consequences

Device does not start up when it should.

Workaround

Do not draw current from VDD pin (external circuitry supply) during power up and ensure VDDH rise time to 3 V is below 1 ms.



4 Fixed anomalies

The anomalies listed in this table are no longer present in the current chip version.

For a detailed description of the fixed anomalies, see the Errata for revision Engineering A nRF52840.

ID	Module	Description
15	POWER	RAM[x].POWERSET/CLR read as zero
54	12S	Wrong LRCK polarity in Aligned mode
58	SPIM	An additional byte is clocked out when RXD.MAXCNT = 1
68	CLOCK	EVENTS_HFCLKSTARTED can be generated before HFCLK is stable
83	TWIS	STOPPED event occurs twice if the STOP task is triggered during a transaction
89	GPIOTE	Static 400 μA current while using GPIOTE
96	12S	DMA buffers can only be located in the first 64 kB of data RAM
97	GPIOTE	High current consumption in System ON Idle mode
98	NFCT	Not able to communicate with the peer
103	ССМ	Reset value of CCM.MAXPACKETSIZE causes encryption, decryption, and MIC failures
104	USBD	EPDATA event is not always generated
110	RADIO	Packet loss or degraded sensitivity
111	RAM	Retention in OFF mode is not controlled by RAM[n].POWER->SxRETENTION, but by RAM[n].POWER->SxPOWER
112	RADIO	False SFD field matches in IEEE 802.15.4 mode RX
113	СОМР	Single-ended mode with external reference is not functional
115	RAM	RAM content cannot be trusted upon waking up from System ON Idle or System OFF mode
116	NFCT	HFCLK not stopped when entering into SENSE_FIELD state
117	System	Reading address 0x40029618 blocks the device
118	QSPI	Reading halfwords or bytes from the XIP region is not supported
119	POWER	Wake up from System OFF on V _{BUS} detect is not functional
121	QSPI	Second read and long read commands fail
127	UARTE	Two stop bit setting is not functional
128	PDM	RATIO register is not functional
131	UARTE	EasyDMA transfer size is limited to 255 bytes
133	CLOCK,RADIO	NRF_RADIO->EVENTS_BCMATCH event might trigger twice
134	USBD	ISOINCONFIG register is not functional



ID	Module	Description
135	USBD	SIZE.ISOOUT register does not report empty incoming packets
140	POWER	REG0 External circuitry supply in LDO mode is not functional in System ON IDLE
142	RADIO	Sensitivity not according to specification
143	RADIO	False CRC failures on specific addresses
144	NFCT	Not optimal NFC performance
145	SPIM	SPIM3 not functional
147	CLOCK	LFRC ULP mode not calibrated in production
150	SAADC	EVENT_STARTED does not fire
151	NVMC	Access to protected memory through Cache
154	USBD	USBD acknowledges setup stage without STATUS task
156	GPIOTE	Some CLR tasks give unintentional behavior
158	RADIO	High power consumption in DISABLED state
160	SAADC	VDDHDIV5 not functional
162	USBD	Writing to registers with offset address 0x52C causes USB to halt
164	RADIO	Low selectivity in long range mode
180	USBD	Wrong PLL calibration in production
181	NFCT	Invalid value in FICR for double-size NFCID1
200	USBD	Cannot write to SIZE.EPOUT register

Table 2: Fixed anomalies

