

nRF52840

Engineering C

Errata

v1.5

Contents

1	nRF52840 Engineering C Errata	4
2	Change log	5
3	New and inherited anomalies	7
3.1	[20] RTC: Register values are invalid	8
3.2	[36] CLOCK: Some registers are not reset when expected	9
3.3	[55] I2S: RXPTRUPD and TXPTRUPD events asserted after STOP	10
3.4	[66] TEMP: Linearity specification not met with default settings	10
3.5	[78] TIMER: High current consumption when using timer STOP task only	11
3.6	[81] GPIO: PIN_CNF is not retained when in debug interface mode	12
3.7	[87] CPU: Unexpected wake from System ON Idle when using FPU	12
3.8	[122] QSPI: QSPI uses current after being disabled	13
3.9	[136] System: Bits in RESETRAS are set when they should not be	13
3.10	[153] RADIO: RSSI parameter adjustment	14
3.11	[155] GPIOTE: IN event may occur more than once on input edge	14
3.12	[166] USB: ISO double buffering not functional	15
3.13	[170] I2S: NRF_I2S->PSEL CONNECT fields are not readable	15
3.14	[171] USB: USB might not power up	16
3.15	[172] RADIO: BLE long range co-channel performance	17
3.16	[173] GPIO: Writes to LATCH register take several CPU cycles to take effect	17
3.17	[174] SPIM: SPIM3 events incorrectly connected to the PPI	18
3.18	[176] System: Flash erase through CTRL-AP fails due to watchdog time-out	18
3.19	[179] RTC: COMPARE event is generated twice from a single RTC compare match	19
3.20	[183] PWM: False SEQEND[0] and SEQEND[1] events	19
3.21	[184] NVMC: Erase or write operations from the external debugger fail when CPU is not halted	20
3.22	[187] USB: USB cannot be enabled	20
3.23	[190] NFCT: Event FIELDDETECTED may be generated too early	21
3.24	[191] RADIO: High packet error rate in BLE Long Range mode	22
3.25	[192] CLOCK: LFRC frequency offset after calibration	22
3.26	[193] SPIM: SPIM3 does not generate EVENTS_END and halts if suspended during last byte	23
3.27	[194] I2S: STOP task does not switch off all resources	23
3.28	[195] SPIM: SPIM3 continues to draw current after disable	24
3.29	[196] I2S: PSEL acquires GPIOs regardless of ENABLE	24
3.30	[197] POWER: DCDC of REG0 not functional	25
3.31	[198] SPIM: SPIM3 transmit data might be corrupted	26
3.32	[199] USB: USB cannot receive tasks during DMA	26
3.33	[201] CLOCK: EVENTS_HFCLKSTARTED might be generated twice	27
3.34	[202] POWER: Device does not start up in high voltage mode	27
3.35	[204] RADIO: Switching between TX and RX causes unwanted emissions	28
3.36	[208] QSPI: PPI Deactivate task does not switch off all resources	28
3.37	[209] CLOCK: LFRC ULP mode calibration not functional	29
3.38	[212] SAADC: Events are not generated when switching from scan mode to no-scan mode with burst enabled	29
3.39	[213] WDT: WDT configuration is cleared when entering system OFF	30
3.40	[214] SPIS: Incorrect data transferred	30
3.41	[215] QSPI: Reading QSPI registers after XIP might halt CPU	31
3.42	[216] QSPI: Race condition occurs in XIP	31
3.43	[218] NFCT: Frame delay timing is too short after SLP_REQ	32

3.44 [219] TWIM: I2C timing spec is violated at 400 kHz	32
3.45 [228] RADIO: No interrupt is generated for SYNC event	33
3.46 [233] NVMC: NVMC READYNEXT not generated	33
3.47 [236] RADIO: Conversion formulas for RADIO energy related values incorrect in PS	34
3.48 [237] SAADC: TASKS_CALIBRATEOFFSET shall only be used before TASKS_START or after EVENTS_END	34
4 Fixed anomalies	35

1 nRF52840 Engineering C Errata

This Errata document contains anomalies for the nRF52840 chip, revision Engineering C (CKAA-CA0, QIAA-CA0).

The document indicates which anomalies are fixed, inherited, or new compared to revision [Engineering B](#).

2 Change log

See the following list for an overview of changes from previous versions of this document.

Version	Date	Change
nRF52840 Engineering C v1.5	10.07.2020	<ul style="list-style-type: none"> • Updated: No. 171. "USB might not power up" • Updated: No. 198. "SPIM3 transmit data might be corrupted" • Added: No. 233. "NVMC READYNEXT not generated" • Added: No. 236. "Conversion formulas for RADIO energy related values incorrect in PS " • Added: No. 237. "TASKS_CALIBRATEOFFSET shall only be used before TASKS_START or after EVENTS_END"
nRF52840 Engineering C v1.4	03.12.2019	<ul style="list-style-type: none"> • Updated: No. 196. "PSEL acquires GPIOs regardless of ENABLE" • Added: No. 212. "Events are not generated when switching from scan mode to no-scan mode with burst enabled" • Added: No. 216. "Race condition occurs in XIP" • Added: No. 218. "Frame delay timing is too short after SLP_REQ" • Added: No. 228. "No interrupt is generated for SYNC event"
nRF52840 Engineering C v1.3	12.09.2019	<ul style="list-style-type: none"> • Added: No. 172. "BLE long range co-channel performance " • Added: No. 199. "USB cannot receive tasks during DMA" • Added: No. 204. "Switching between TX and RX causes unwanted emissions" • Added: No. 208. "PPI Deactivate task does not switch off all resources" • Added: No. 209. "LFRC ULP mode calibration not functional" • Added: No. 213. "WDT configuration is cleared when entering system OFF" • Added: No. 214. "Incorrect data transferred" • Added: No. 215. "Reading QSPI registers after XIP might halt CPU" • Added: No. 219. "I2C timing spec is violated at 400 kHz"
nRF52840 Engineering C v1.2	30.05.2018	<ul style="list-style-type: none"> • Updated: No. 202. "Device does not start up in high voltage mode"

Version	Date	Change
nRF52840 Engineering C v1.1	23.03.2018	<ul style="list-style-type: none"> • Updated: No. 171. "USB might not power up" • Added: No. 122. "QSPI uses current after being disabled" • Added: No. 190. "Event FIELDDETECTED may be generated too early" • Added: No. 192. "LFRC frequency offset after calibration" • Added: No. 194. "STOP task does not switch off all resources" • Added: No. 195. "SPIM3 continues to draw current after disable" • Added: No. 196. "PSEL acquires GPIOs regardless of ENABLE" • Added: No. 197. "DCDC of REG0 not functional" • Added: No. 198. "SPIM3 transmit data might be corrupted" • Added: No. 201. "EVENTS_HFCLKSTARTED might be generated twice" • Added: No. 202. "Device does not start up in high voltage mode"
nRF52840 Engineering C v1.0	09.02.2018	<ul style="list-style-type: none"> • Added: No. 20. "Register values are invalid" • Added: No. 36. "Some registers are not reset when expected" • Added: No. 55. "RXPTRUPD and TXPTRUPD events asserted after STOP" • Added: No. 66. "Linearity specification not met with default settings" • Added: No. 78. "High current consumption when using timer STOP task only" • Added: No. 81. "PIN_CNF is not retained when in debug interface mode" • Added: No. 87. "Unexpected wake from System ON Idle when using FPU" • Added: No. 136. "Bits in RESETREAS are set when they should not be" • Added: No. 153. "RSSI parameter adjustment" • Added: No. 155. "IN event may occur more than once on input edge" • Added: No. 166. "ISO double buffering not functional" • Added: No. 170. "NRF_I2S->PSEL CONNECT fields are not readable" • Added: No. 171. "USB might not power up" • Added: No. 173. "Writes to LATCH register take several CPU cycles to take effect" • Added: No. 174. "SPIM3 events incorrectly connected to the PPI" • Added: No. 176. "Flash erase through CTRL-AP fails due to watchdog time-out" • Added: No. 179. "COMPARE event is generated twice from a single RTC compare match" • Added: No. 183. "False SEQEND[0] and SEQEND[1] events" • Added: No. 184. "Erase or write operations from the external debugger fail when CPU is not halted" • Added: No. 187. "USB cannot be enabled" • Added: No. 191. "High packet error rate in BLE Long Range mode" • Added: No. 193. "SPIM3 does not generate EVENTS_END and halts if suspended during last byte"

3 New and inherited anomalies

The following anomalies are present in revision Engineering C of the nRF52840 chip.

ID	Module	Description	New in Engineering C	Inherited from Engineering B
20	RTC	Register values are invalid		X
36	CLOCK	Some registers are not reset when expected		X
55	I2S	RXPTRUPD and TXPTRUPD events asserted after STOP		X
66	TEMP	Linearity specification not met with default settings		X
78	TIMER	High current consumption when using timer STOP task only		X
81	GPIO	PIN_CNF is not retained when in debug interface mode		X
87	CPU	Unexpected wake from System ON Idle when using FPU		X
122	QSPI	QSPI uses current after being disabled		X
136	System	Bits in RESETREAS are set when they should not be		X
153	RADIO	RSSI parameter adjustment		X
155	GPIO	IN event may occur more than once on input edge		X
166	USB	ISO double buffering not functional		X
170	I2S	NRF_I2S->PSEL CONNECT fields are not readable		X
171	USB	USB might not power up		X
172	RADIO	BLE long range co-channel performance		X
173	GPIO	Writes to LATCH register take several CPU cycles to take effect		X
174	SPIM	SPIM3 events incorrectly connected to the PPI		X
176	System	Flash erase through CTRL-AP fails due to watchdog time-out		X
179	RTC	COMPARE event is generated twice from a single RTC compare match		X
183	PWM	False SEQEND[0] and SEQEND[1] events		X
184	NVMC	Erase or write operations from the external debugger fail when CPU is not halted		X
187	USB	USB cannot be enabled		X
190	NFCT	Event FIELDDETECTED may be generated too early		X
191	RADIO	High packet error rate in BLE Long Range mode		X

ID	Module	Description	New in Engineering C	Inherited from Engineering B
192	CLOCK	LFRC frequency offset after calibration		X
193	SPIM	SPIM3 does not generate EVENTS_END and halts if suspended during last byte		X
194	I2S	STOP task does not switch off all resources		X
195	SPIM	SPIM3 continues to draw current after disable		X
196	I2S	PSEL acquires GPIOs regardless of ENABLE		X
197	POWER	DCDC of REG0 not functional	X	
198	SPIM	SPIM3 transmit data might be corrupted		X
199	USB	USB cannot receive tasks during DMA		X
201	CLOCK	EVENTS_HFCLKSTARTED might be generated twice		X
202	POWER	Device does not start up in high voltage mode		X
204	RADIO	Switching between TX and RX causes unwanted emissions		X
208	QSPI	PPI Deactivate task does not switch off all resources		X
209	CLOCK	LFRC ULP mode calibration not functional		X
212	SAADC	Events are not generated when switching from scan mode to no-scan mode with burst enabled	X	
213	WDT	WDT configuration is cleared when entering system OFF		X
214	SPIS	Incorrect data transferred		X
215	QSPI	Reading QSPI registers after XIP might halt CPU		X
216	QSPI	Race condition occurs in XIP		X
218	NFCT	Frame delay timing is too short after SLP_REQ	X	
219	TWIM	I2C timing spec is violated at 400 kHz		X
228	RADIO	No interrupt is generated for SYNC event		X
233	NVMC	NVMC READYNEXT not generated		X
236	RADIO	Conversion formulas for RADIO energy related values incorrect in PS		X
237	SAADC	TASKS_CALIBRATEOFFSET shall only be used before TASKS_START or after EVENTS_END		X

Table 1: New and inherited anomalies

3.1 [20] RTC: Register values are invalid

This anomaly applies to IC Rev. Engineering C, build codes CKA0-CA0, QIAA-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

RTC registers will not contain the correct/expected value if read.

Conditions

The RTC has been idle.

Consequences

RTC configuration cannot be determined by reading RTC registers.

Workaround

Execute the below code before you use RTC.

```
NRF_CLOCK->EVENTS_LFCLKSTARTED = 0;
NRF_CLOCK->TASKS_LFCLKSTART     = 1;
while (NRF_CLOCK->EVENTS_LFCLKSTARTED == 0) {}
NRF_RTC0->TASKS_STOP = 0;
```

3.2 [36] CLOCK: Some registers are not reset when expected

This anomaly applies to IC Rev. Engineering C, build codes CKAA-CA0, QIAA-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

After watchdog timeout reset, CPU lockup reset, soft reset, or pin reset, the following CLOCK peripheral registers are not reset:

- CLOCK->EVENTS_DONE
- CLOCK->EVENTS_CTTO
- CLOCK->CTIV

Conditions

After watchdog timeout reset, CPU Lockup reset, soft reset, and pin reset.

Consequences

Register reset values might be incorrect. It may cause undesired interrupts in case of enabling interrupts without clearing the DONE or CTTO events.

Workaround

Clear affected registers after reset. This workaround has already been added into system_nrf52.c file. This workaround has already been added into system_nrf52840.c file present in MDK 8.11.0 or later.

3.3 [55] I2S: RXPTRUPD and TXPTRUPD events asserted after STOP

This anomaly applies to IC Rev. Engineering C, build codes CKAA-CA0, QIAA-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

The RXPTRUPD event is generated when the STOP task is triggered, even though reception (RX) is disabled. Similarly, the TXPTRUPD event is generated when the STOP task is triggered, even though transmission (TX) is disabled.

Conditions

A previous transfer has been performed with RX/TX enabled, respectively.

Consequences

The indication that RXTXD.MAXCNT words were received/transmitted is false.

Workaround

Ignore the RXPTRUPD and TXPTRUPD events after triggering the STOP task. Clear these events before starting the next transfer.

3.4 [66] TEMP: Linearity specification not met with default settings

This anomaly applies to IC Rev. Engineering C, build codes CKAA-CA0, QIAA-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

TEMP module provides non-linear temperature readings over the specified temperature range.

Conditions

Always.

Consequences

TEMP module returns out of spec temperature readings.

Workaround

Execute the following code after reset:

```
NRF_TEMP->A0 = NRF_FICR->TEMP.A0;
NRF_TEMP->A1 = NRF_FICR->TEMP.A1;
NRF_TEMP->A2 = NRF_FICR->TEMP.A2;
NRF_TEMP->A3 = NRF_FICR->TEMP.A3;
NRF_TEMP->A4 = NRF_FICR->TEMP.A4;
NRF_TEMP->A5 = NRF_FICR->TEMP.A5;
NRF_TEMP->B0 = NRF_FICR->TEMP.B0;
NRF_TEMP->B1 = NRF_FICR->TEMP.B1;
NRF_TEMP->B2 = NRF_FICR->TEMP.B2;
NRF_TEMP->B3 = NRF_FICR->TEMP.B3;
NRF_TEMP->B4 = NRF_FICR->TEMP.B4;
NRF_TEMP->B5 = NRF_FICR->TEMP.B5;
NRF_TEMP->T0 = NRF_FICR->TEMP.T0;
NRF_TEMP->T1 = NRF_FICR->TEMP.T1;
NRF_TEMP->T2 = NRF_FICR->TEMP.T2;
NRF_TEMP->T3 = NRF_FICR->TEMP.T3;
NRF_TEMP->T4 = NRF_FICR->TEMP.T4;
```

This code is already present in the latest `system_nrf52.c` file and in the `system_nrf52840.c` file released in MDK 8.12.0.

3.5 [78] TIMER: High current consumption when using timer STOP task only

This anomaly applies to IC Rev. Engineering C, build codes CKAA-CA0, QIAA-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

Increased current consumption when the timer has been running and the STOP task is used to stop it.

Conditions

The timer has been running (after triggering a START task) and then it is stopped using a STOP task only.

Consequences

Increased current consumption.

Workaround

Use the SHUTDOWN task after the STOP task or instead of the STOP task.

3.6 [81] GPIO: PIN_CNF is not retained when in debug interface mode

This anomaly applies to IC Rev. Engineering C, build codes CKAA-CA0, QIAA-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

GPIO pin configuration is reset on wakeup from System OFF.

Conditions

The system is in debug interface mode.

Consequences

GPIO state unreliable until PIN_CNF is reconfigured.

3.7 [87] CPU: Unexpected wake from System ON Idle when using FPU

This anomaly applies to IC Rev. Engineering C, build codes CKAA-CA0, QIAA-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

The CPU is unexpectedly awoken from System ON Idle.

Conditions

The FPU has been used.

Consequences

The CPU is awoken from System ON Idle.

Workaround

The FPU can generate pending interrupts just like other peripherals, but unlike other peripherals there are no INTENSET, INTENCLR registers for enabling or disabling interrupts at the peripheral level. In order to prevent unexpected wake-up from System ON Idle, add this code before entering sleep:

```
#if (__FPU_USED == 1)
    __set_FPSCR(__get_FPSCR() & ~(0x0000009F));
    (void) __get_FPSCR();
    NVIC_ClearPendingIRQ(FPU_IRQn);
#endif
__WFE();
```

3.8 [122] QSPI: QSPI uses current after being disabled

This anomaly applies to IC Rev. Engineering C, build codes CKAA-CA0, QIAA-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

Current consumption is too high.

Conditions

After QSPI has been activated by the use of TASKS_ACTIVATE task.

Consequences

Current consumption is too high.

Workaround

Execute the following code before disabling QSPI:

```
*(volatile uint32_t *)0x40029010ul = 1ul;  
*(volatile uint32_t *)0x40029054ul = 1ul
```

3.9 [136] System: Bits in RESETREAS are set when they should not be

This anomaly applies to IC Rev. Engineering C, build codes CKAA-CA0, QIAA-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

After pin reset, RESETREAS bits other than RESETPIN might also be set.

Conditions

A pin reset has triggered.

Consequences

If the firmware evaluates RESETREAS, it might take the wrong action.

Workaround

When RESETREAS shows a pin reset (RESETPIN), ignore other reset reason bits.

Important: RESETREAS bits must be cleared between resets.

Apply the following code after any reset:

```
if (NRF_POWER->RESETPIN & POWER_RESETPIN_RESETPIN_Msk) {
    NRF_POWER->RESETPIN = ~POWER_RESETPIN_RESETPIN_Msk;
}
```

This workaround is implemented in MDK version 8.13.0 and later.

3.10 [153] RADIO: RSSI parameter adjustment

This anomaly applies to IC Rev. Engineering C, build codes CKAA-CA0, QIAA-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

RSSI changes over temperature.

Conditions

Temperature $\leq +10^{\circ}\text{C}$ or $> +30^{\circ}\text{C}$.

Consequences

RSSI parameter not within specified accuracy.

Workaround

Add the following compensation to the RSSI sample value based on temperature measurement (the on-chip TEMP peripheral can be used to measure temperature):

- For $\text{TEMP} \leq -30^{\circ}\text{C}$, $\text{RSSISAMPLE} = \text{RSSISAMPLE} + 3$
- For $\text{TEMP} > -30^{\circ}\text{C}$ and $\text{TEMP} \leq -10^{\circ}\text{C}$, $\text{RSSISAMPLE} = \text{RSSISAMPLE} + 2$
- For $\text{TEMP} > -10^{\circ}\text{C}$ and $\text{TEMP} \leq +10^{\circ}\text{C}$, $\text{RSSISAMPLE} = \text{RSSISAMPLE} + 1$
- For $\text{TEMP} > +10^{\circ}\text{C}$ and $\text{TEMP} \leq +30^{\circ}\text{C}$, $\text{RSSISAMPLE} = \text{RSSISAMPLE} + 0$
- For $\text{TEMP} > +30^{\circ}\text{C}$ and $\text{TEMP} \leq +50^{\circ}\text{C}$, $\text{RSSISAMPLE} = \text{RSSISAMPLE} - 1$
- For $\text{TEMP} > +50^{\circ}\text{C}$ and $\text{TEMP} \leq +70^{\circ}\text{C}$, $\text{RSSISAMPLE} = \text{RSSISAMPLE} - 2$
- For $\text{TEMP} > +70^{\circ}\text{C}$, $\text{RSSISAMPLE} = \text{RSSISAMPLE} - 3$

3.11 [155] GPIOTE: IN event may occur more than once on input edge

This anomaly applies to IC Rev. Engineering C, build codes CKAA-CA0, QIAA-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

IN event occurs more than once on an input edge.

Conditions

Input signal edges are closer together than $1.3 \mu\text{s}$ or $\geq 750 \text{ kHz}$ for a periodic signal.

Consequences

Tasks connected through PPI or SHORTS to this event might be triggered twice.

Workaround

Apply the following code when any GPIOTE channel is configured to generate an IN event on edges that can occur within 1.3 μ s of each other:

```
*(volatile uint32_t *) (NRF_GPIOTE_BASE + 0x600 + (4 * GPIOTE_CH_USED)) = 1;
```

Important: A clock is kept on by the workaround and must be reverted to avoid higher current consumption when GPIOTE is not in use, using the following code:

```
*(volatile uint32_t *) (NRF_GPIOTE_BASE + 0x600 + (4 * GPIOTE_CH_USED)) = 0;
```

3.12 [166] USB: ISO double buffering not functional

This anomaly applies to IC Rev. Engineering C, build codes CKAA-CA0, QIAA-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

The double buffering of the ISO EPs of the USB is not functional.

Conditions

Always. With default settings, the buffers overlap.

Consequences

During ISO transition, received or transmitted data is likely to be corrupted.

Workaround

Reconfigure ISO buffers during initialization of USB. After each time the USB peripheral is enabled, apply the following code:

```
*((volatile uint32_t *) (NRF_USBD_BASE + 0x800)) = 0x7E3;
*((volatile uint32_t *) (NRF_USBD_BASE + 0x804)) = 0x40;
```

3.13 [170] I2S: NRF_I2S->PSEL CONNECT fields are not readable

This anomaly applies to IC Rev. Engineering C, build codes CKAA-CA0, QIAA-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

- CONNECT field of NRF_I2S->PSEL.MCK is not readable.
- CONNECT field of NRF_I2S->PSEL.SCK is not readable.
- CONNECT field of NRF_I2S->PSEL.LRCK is not readable.
- CONNECT field of NRF_I2S->PSEL.SDIN is not readable.
- CONNECT field of NRF_I2S->PSEL.SDOOUT is not readable.

Conditions

Always.

Consequences

When reading the value of NRF_I2S->PSEL registers, the CONNECT field might not return the same value that has been written to it.

Workaround

None.

3.14 [171] USB_D: USB might not power up

This anomaly applies to IC Rev. Engineering C, build codes CKAA-CA0, QIAA-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

The USB_D might not reach its active state. It is also possible that the USB_D reaches its active state, but with an increased delay.

Conditions

Firmware enables USB_D or exits USB_D low power mode (clears USB_D->LOWPOWER) and enters System ON IDLE before the USB_D module is fully powered up.

Consequences

The USB_D sometimes does not function.

Workaround

To enable the USB_D (USB_D.ENABLE = 1) or to wake the USB_D during SUSPEND (USB_D.LOWPOWER = 0), apply the following code:

```
if(*(volatile uint32_t *)0x4006EC00 == 0x00000000)
{
    *(volatile uint32_t *)0x4006EC00 = 0x00009375;
}
*(volatile uint32_t *)0x4006EC14 = 0x000000C0;
*(volatile uint32_t *)0x4006EC00 = 0x00009375;

NRF_USB_D->ENABLE = 0x00000001; // or NRF_USB_D->LOWPOWER = 0x00000000;
```


After receiving the corresponding acknowledgment event (i.e. USBD.EVENTS_USBEVENT with USBD.EVENTCAUSE.READY=1 in case of enabling or USBD->EVENTCAUSE.USBWUALLOWED=1 in case of wakeup), apply the following code:

```
if(*(volatile uint32_t *)0x4006EC00 == 0x00000000)
{
    *(volatile uint32_t *)0x4006EC00 = 0x00009375;
}
*(volatile uint32_t *)0x4006EC14 = 0x00000000;
*(volatile uint32_t *)0x4006EC00 = 0x00009375;
```

3.15 [172] RADIO: BLE long range co-channel performance

This anomaly applies to IC Rev. Engineering C, build codes CKAA-CA0, QIAA-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

Packet loss when a blocker signal is present.

Conditions

BLE long range (Ble_LR125Kbit or Ble_LR500Kbit). Blocker signal present at the same or nearby RF frequency.

Consequences

Fails BLE test with co-channel interference (RF-PHY/RCV/BV-29-C) without FW workaround.

Workaround

Workaround is incorporated into S140 SoftDevice v6.1.1 and the DTM example in SDK v15.3.0. See the following document for a description of the workarounds:

[nRF52840 Errata Attachment Anomaly 172 Addendum](#)

3.16 [173] GPIO: Writes to LATCH register take several CPU cycles to take effect

This anomaly applies to IC Rev. Engineering C, build codes CKAA-CA0, QIAA-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

A bit in the LATCH register reads '1' even after clearing it by writing '1'.

Conditions

Reading the LATCH register right after writing to it.

Consequences

Old value of the LATCH register is read.

Workaround

Have at least 3 CPU cycles of delay between the write and the subsequent read to the LATCH register. This can be achieved by having 3 dummy reads to the LATCH register.

3.17 [174] SPIM: SPIM3 events incorrectly connected to the PPI

This anomaly applies to IC Rev. Engineering C, build codes CKA0-CA0, QIA0-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

Tasks triggered from the PPI using EVENTS_ENDRX or EVENTS_ENDTX of SPIM3 do not happen when expected.

Conditions

Always.

Consequences

EVENTS_ENDRX and EVENTS_ENDTX of SPIM3 have their connections to the PPI swapped. Tasks triggered by the PPI from EVENTS_ENDRX or EVENTS_ENDTX of SPIM3 do not happen when expected.

Workaround

When configuring the PPI to trigger a task on EVENTS_ENDRX, program the CH[N].EEP register with the address of EVENTS_ENDTX. When configuring the PPI to trigger a task on EVENTS_ENDTX, program the CH[N].EEP register with the address of EVENTS_ENDRX.

This only applies to the SPIM3 instance.

3.18 [176] System: Flash erase through CTRL-AP fails due to watchdog time-out

This anomaly applies to IC Rev. Engineering C, build codes CKA0-CA0, QIA0-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

Full flash erase through CTRL-AP is not successful.

Conditions

WDT is enabled.

Consequences

Flash is not erased. If the device has a WDT time-out less than 1 ms and is readback-protected through UICR.APPROTECT, there is a risk of permanently preventing the erasing of the flash.

Workaround

Try again.

3.19 [179] RTC: COMPARE event is generated twice from a single RTC compare match

This anomaly applies to IC Rev. Engineering C, build codes CKAA-CA0, QIAA-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

Tasks connected to RTC COMPARE event through PPI are triggered twice per compare match.

Conditions

RTC registers are being accessed by CPU while RTC is running.

Consequences

Tasks connected to RTC COMPARE event through PPI are triggered more often than expected.

Workaround

Do not access the RTC registers, including the COMPARE event register, from CPU while waiting for the RTC COMPARE event. Note that CPU interrupt from this event can still be enabled.

3.20 [183] PWM: False SEQEND[0] and SEQEND[1] events

This anomaly applies to IC Rev. Engineering C, build codes CKAA-CA0, QIAA-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

False SEQEND[0] and SEQEND[1] events are being generated.

Conditions

Any of the LOOPSDONE_SEQSTARTn shortcuts are enabled. LOOP register is non-zero and sequence 1 is one value long.

Consequences

SEQEND[0] and SEQEND[1] events might falsely trigger other tasks if these are routed through the PPI.

Workaround

Avoid using the `LOOPSDONE_SEQSTARTn` shortcuts, when `LOOP` register is non-zero and sequence 1 is one value long.

3.21 [184] NVMC: Erase or write operations from the external debugger fail when CPU is not halted

This anomaly applies to IC Rev. Engineering C, build codes CKA0-CA0, QIA0-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

The erase or write operation fails or takes longer time than specified.

Conditions

NVMC erase or write operation initiated using an external debugger. CPU is not halted.

Consequences

The NVMC erase or write operation fails or takes longer time than specified.

Workaround

Halt the CPU by writing to `DHCSR` (Debug Halting Control and Status Register) before starting NVMC erase or write operation from the external debugger. See the ARM infocenter to get the details of the `DHCSR` register.

Programming tools provided by Nordic Semiconductor comply with this.

3.22 [187] USB: USB cannot be enabled

This anomaly applies to IC Rev. Engineering C, build codes CKA0-CA0, QIA0-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

After writing to `NRF_USBD->ENABLE`, no `EVENTS_USBEVENT` is triggered, and `USB->EVENTCAUSE` is not updated.

Conditions

Most recent reset type is soft reset or CPU lockup reset, or after a new firmware update to flash.

Consequences

USB is not working.

Workaround

Implement code similar to the following around the USB enabling:

```

*(volatile uint32_t *)0x4006EC00 = 0x00009375;
*(volatile uint32_t *)0x4006ED14 = 0x00000003;
*(volatile uint32_t *)0x4006EC00 = 0x00009375;

/* Enable the peripheral */
NRF_USBD->ENABLE = USBD_ENABLE_ENABLE_Enabled<< USBD_ENABLE_ENABLE_Pos;

/* Waiting for peripheral to enable, this should take a few µs */
while (0 == (NRF_USBD->EVENTCAUSE & USBD_EVENTCAUSE_READY_Msk))
{
    /* Empty loop */
}
NRF_USBD->EVENTCAUSE &= ~USB_EVENTCAUSE_READY_Msk;

*(volatile uint32_t *)0x4006EC00 = 0x00009375;
*(volatile uint32_t *)0x4006ED14 = 0x00000000;
*(volatile uint32_t *)0x4006EC00 = 0x00009375;

```

nRF5 SDK version 15 will include this workaround.

3.23 [190] NFCT: Event FIELDDETECTED may be generated too early

This anomaly applies to IC Rev. Engineering C, build codes CKAA-CA0, QIAA-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

Reset of the operating state after FIELDLOST event. In some cases, communication with the peer device is not possible.

Conditions

Always. Especially with stronger field strengths.

Consequences

Restart of transfer required.

Workaround

On FIELDDETECTED event, wait 1 ms (using timer) before starting NFC communication with NRF_NFCT->TASKS_ACTIVATE.

This workaround is included in SDK v15.0.0.

3.24 [191] RADIO: High packet error rate in BLE Long Range mode

This anomaly applies to IC Rev. Engineering C, build codes CKA0-CA0, QIA0-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

High packet error rate.

Conditions

BLE Long Range mode.

Consequences

Poor communication link.

Workaround

Use the following setting for the radio in BLE LR mode (set after power-on-reset and whenever NRF_RADIO->POWER has been low):

```
* (volatile uint32_t *) 0x40001740 = (((*(volatile uint32_t *) 0x40001740) & 0x7FFF00FF) |
0x80000000 | (((uint32_t) 196) << 8));
```

When switching from BLE LR mode to any other radio mode, use the following code to return to default settings:

```
* (volatile uint32_t *) 0x40001740 = (((*(volatile uint32_t *) 0x40001740) & 0x7FFFFFFF);
```

3.25 [192] CLOCK: LFRC frequency offset after calibration

This anomaly applies to IC Rev. Engineering C, build codes CKA0-CA0, QIA0-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

LFRC oscillator frequency is wrong after calibration, exceeding 500 ppm.

Conditions

On some devices, when entering System ON Idle while calibration is ongoing.

Consequences

After calibration, LFRC has a frequency offset that is outside specification.

Workaround

Apply the following code before starting the RCOSC32K calibration:

```
*(volatile uint32_t *)0x40000C34 = 0x00000002;
```

Apply the following code after the RCOSC32K calibration is finished:

```
*(volatile uint32_t *)0x40000C34 = 0x00000000;
```

This workaround is included in SDK v15.0.0 and SoftDevices S140, S132, and S112 v6.0.0.

3.26 [193] SPIM: SPIM3 does not generate EVENTS_END and halts if suspended during last byte

This anomaly applies to IC Rev. Engineering C, build codes CKA0-CA0, QIA0-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

SPIM3 stops working.

Conditions

Using TASKS_SUSPEND on SPIM3 during last byte.

Consequences

EVENTS_END is not generated and SPIM3 stops working.

Workaround

Do not use TASKS_SUSPEND for SPIM3 unless the application can guarantee that it will not be triggered during the transfer of the last byte. There is no indication from SPIM3 that it is currently in the last byte transfer.

If TASKS_SUSPEND was used during transmission of the last byte, recover SPIM3 by power cycling the device or restart SPIM3 using the following code:

```
*(volatile uint32_t *)0x4002FFFC = 0;
*(volatile uint32_t *)0x4002FFFC;
*(volatile uint32_t *)0x4002FFFC = 1;
```

3.27 [194] I2S: STOP task does not switch off all resources

This anomaly applies to IC Rev. Engineering C, build codes CKA0-CA0, QIA0-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

Current consumption too high (~900 µA) after using the STOP task.

Conditions

I2S was running and was stopped by triggering the STOP task.

Consequences

Current consumption higher than specified.

Workaround

Apply the following code after the STOP task:

```
*((volatile uint32_t *)0x40025038) = 1;  
*((volatile uint32_t *)0x4002503C) = 1;
```

3.28 [195] SPIM: SPIM3 continues to draw current after disable

This anomaly applies to IC Rev. Engineering C, build codes CKAA-CA0, QIAA-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

Current consumption higher than specified when disabling the SPIM3.

Conditions

When disabling the SPIM3.

Consequences

Current consumption around 900 µA higher than specified.

Workaround

Apply the following workaround after disabling the SPIM3 (`NRF_SPIM3->ENABLE = 0`):

```
*((volatile uint32_t *)0x4002F004) = 1;
```

3.29 [196] I2S: PSEL acquires GPIOs regardless of ENABLE

This anomaly applies to IC Rev. Engineering C, build codes CKAA-CA0, QIAA-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

I2S controls GPIO even when I2S is not enabled.

Conditions

When using I2S->PSEL to configure GPIO.

Consequences

GPIO selected for I2S cannot be used for any other peripheral and will be configured as input.

Workaround

Do not rely on the pins selected in I2S->PSEL registers being free when I2S->ENABLE is set to DISABLE.

Only set the CONNECT bit in the I2S->PSEL registers to CONNECTED immediately before enabling I2S. When disabling I2S, set the CONNECT bit in the I2S->PSEL registers to DISCONNECTED.

3.30 [197] POWER: DCDC of REG0 not functional

This anomaly applies to IC Rev. Engineering C, build codes CKAA-CA0, QIAA-CA0.

Symptoms

VDD voltage drop below specification when entering low power modes. Low voltage may trigger reset of device.

Conditions

Using DCDC on REG0, high voltage mode. DCDC on REG1 is not affected.

Consequences

Cannot use DCDC and switch to ultra-low power mode (autonomous). Cannot support external circuitry supply.

Workaround

One of the following options:

1. Do not enable DCDC.

Consequences: Loss of efficiency with high dropout between VDDH and VDD. Supports external circuitry supply.

2. Prevent REG0 stage to go to ULP mode. At startup and after reset, write 0x00000001 to register 0x40000638.

Consequences: High current consumption in System ON IDLE (~300 μ A). Cannot support external circuitry supply.

3.31 [198] SPIM: SPIM3 transmit data might be corrupted

This anomaly applies to IC Rev. Engineering C, build codes CKA0-CA0, QIA0-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

Transmit data from SPIM3 is corrupted.

Conditions

Data accessed by CPU location in the same RAM AHB slave as where the SPIM3 TXD.PTR is pointing, and CPU does a read or write operation at the same clock cycle as the SPIM3 EasyDMA is fetching data. This case should have been handled by the stalling mechanism.

Consequences

Transmit data from SPIM3 is corrupted.

Workaround

Reserve dedicated RAM AHB slave for the SPIM3 transmit buffer, not overlapping with application data used by the CPU. In addition, synchronize so that the CPU is not writing data to the transmit buffer while SPIM is transmitting data.

3.32 [199] USB: USB cannot receive tasks during DMA

This anomaly applies to IC Rev. Engineering C, build codes CKA0-CA0, QIA0-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

The USB cannot perform incoming tasks.

Conditions

The USB is performing a DMA transfer.

Consequences

If any EasyDMA transfer is in progress, USB tasks cannot be used.

Workaround

To enable incoming tasks when using DMA, use the following code when starting a DMA transfer:

```
*(volatile uint32_t *)0x40027C1C = 0x00000082;
```

After the DMA transfer is completed, use:

```
*(volatile uint32_t *)0x40027C1C = 0x00000000;
```

3.33 [201] CLOCK: EVENTS_HFCLKSTARTED might be generated twice

This anomaly applies to IC Rev. Engineering C, build codes CKA0-CA0, QIA0-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

EVENTS_HFCLKSTARTED might occur twice, and HFCLKSTAT might be wrong.

Conditions

When running HFCLK with crystal.

Consequences

HFCLKSTAT might be wrong when reading it after HFCLK is started.

Workaround

Disregard HFCLKSTAT and EVENT_HFCLKSTARTED after first EVENT_HFCLKSTARTED.

This workaround is included in nRF5 SDK v15.0.0 and SoftDevices S140, S132, and S112 v6.0.0.

3.34 [202] POWER: Device does not start up in high voltage mode

This anomaly applies to IC Rev. Engineering C, build codes CKA0-CA0, QIA0-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

Device does not start up in high voltage mode.

Conditions

Using REG0 and external circuitry supply or slow rise time on VDDH. Power on reset (POR) may not release correctly.

Consequences

Device does not start up when it should.

Workaround

Do not draw current from VDD pin (external circuitry supply) during power up and ensure VDDH rise time to 3 V is below 1 ms.

3.35 [204] RADIO: Switching between TX and RX causes unwanted emissions

This anomaly applies to IC Rev. Engineering C, build codes CKA0-CA0, QIA0-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

Unwanted emissions are experienced when switching from TX to RX.

Conditions

Switching from TX to RX without using DISABLE.

Consequences

Unwanted emissions occur on the channel used for RX.

Workaround

Always use DISABLE when switching from TX to RX.

3.36 [208] QSPI: PPI Deactivate task does not switch off all resources

This anomaly applies to IC Rev. Engineering C, build codes CKA0-CA0, QIA0-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

Current consumption is higher than expected after triggering TASKS_DEACTIVATE from the PPI.

Conditions

QSPI was running and was stopped by triggering TASKS_DEACTIVATE from the PPI.

Consequences

Current consumption higher than expected.

Workaround

Use software to write to the TASKS_DEACTIVATE register instead of triggering TASKS_DEACTIVATE from the PPI.

3.37 [209] CLOCK: LFRC ULP mode calibration not functional

This anomaly applies to IC Rev. Engineering C, build codes CKAA-CA0, QIAA-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

LFRC stops.

Conditions

Sometimes when using LFRC ULP mode and performing calibration.

Consequences

LFRC ULP mode cannot be calibrated.

Workaround

Use LFRC ULP mode without calibrating, or use LFRC normal mode if calibration is required.

3.38 [212] SAADC: Events are not generated when switching from scan mode to no-scan mode with burst enabled

This anomaly applies to IC Rev. Engineering C, build codes CKAA-CA0, QIAA-CA0.

Symptoms

SAADC stops working.

Conditions

Any of the following:

- Switching from multiple channels to single channel when BURST is disabled and acquisition time < 10 μ s.
- Switching from multiple channels to single channel when BURST is enabled.

Consequences

SAADC does not generate the expected events.

Workaround

Execute the following code before changing the channel configuration:

```
volatile uint32_t temp1;
volatile uint32_t temp2;
volatile uint32_t temp3;

temp1 = *(volatile uint32_t *)0x40007640ul;
temp2 = *(volatile uint32_t *)0x40007644ul;
temp3 = *(volatile uint32_t *)0x40007648ul;

*(volatile uint32_t *)0x40007FFCul = 0ul;
*(volatile uint32_t *)0x40007FFCul;
*(volatile uint32_t *)0x40007FFCul = 1ul;

*(volatile uint32_t *)0x40007640ul = temp1;
*(volatile uint32_t *)0x40007644ul = temp2;
*(volatile uint32_t *)0x40007648ul = temp3;
```

After the workaround is executed, the SAADC configuration is reset. Before use all registers must be configured again.

3.39 [213] WDT: WDT configuration is cleared when entering system OFF

This anomaly applies to IC Rev. Engineering C, build codes CKAA-CA0, QIAA-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

WDT configuration has been cleared when device wakes from System OFF.

Conditions

Always.

Consequences

WDT does not resume function as expected.

Workaround

Reconfigure WDT after wake-up from System OFF.

3.40 [214] SPIS: Incorrect data transferred

This anomaly applies to IC Rev. Engineering C, build codes CKAA-CA0, QIAA-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

Wrong data is transferred.

Conditions

If SPIS is disabled while CSN is asserted.

Consequences

Unsent byte from previous transmission is transferred as first byte of new transmission.

Workaround

After disabling the SPIS n instance (writing `SPIS n ->ENABLE = SPIS_ENABLE_ENABLE_Disable`), apply the following code:

```

*(volatile uint32_t *) (NRF_SPIS $n$ _BASE + 0xA4u1) = 1u1;
*(volatile uint32_t *) (NRF_SPIS $n$ _BASE + 0xACu1) = 1u1;

```

3.41 [215] QSPI: Reading QSPI registers after XIP might halt CPU

This anomaly applies to IC Rev. Engineering C, build codes CKAA-CA0, QIAA-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

CPU halts.

Conditions

Init and start QSPI, use XIP, then write to or read any QSPI register with an offset above 0x600.

Consequences

CPU halts.

Workaround

Trigger QSPI `TASKS_ACTIVATE` after XIP is used before accessing any QSPI register with an offset above 0x600.

3.42 [216] QSPI: Race condition occurs in XIP

This anomaly applies to IC Rev. Engineering C, build codes CKAA-CA0, QIAA-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

Data read from the XIP area is incorrect.

Conditions

Code that is executing from internal flash memory or RAM reads data located in the XIP region. The read performs two consecutive LDR instructions from XIP addresses where the result of the first LDR instruction is used as the address of the second LDR. This occurs, for example, when dereferencing a pointer located in the XIP addresses.

Consequences

Data read from the XIP area is incorrect.

Workaround

To avoid the race condition, perform one of the following:

- Copy the read-only data into internal RAM before accessing it using the memcopy() function.
- Place the read-only data in internal flash memory in the linker script at compile time.

3.43 [218] NFCT: Frame delay timing is too short after SLP_REQ

This anomaly applies to IC Rev. Engineering C, build codes CKAA-CA0, QIAA-CA0.

Symptoms

Reader may not accept the response from the tag.

Conditions

The time between SLP_REQ and ALL_REQ sent by the Reader is shorter than the time configured in FRAMEDELAYMAX.

Consequences

The protocol timing is violated and a Reader may not accept the response from the tag.

Workaround

Ensure that FRAMEDELAYMAX is set to the default value when the NFCT is in states IDLE or SLEEP_A. The workaround is included in nRF5 SDK v16.0

3.44 [219] TWIM: I2C timing spec is violated at 400 kHz

This anomaly applies to IC Rev. Engineering C, build codes CKAA-CA0, QIAA-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

The low period of the SCL clock is too short to meet the I2C specification at 400 kHz. The actual low period of the SCL clock is 1.25 μ s while the I2C specification requires the SCL clock to have a minimum low period of 1.3 μ s.

Conditions

Using TWIM at 400 kHz.

Consequences

TWI communication might not work at 400 kHz with I2C compatible devices.

Workaround

If communication does not work at 400 kHz with an I2C compatible device that requires the SCL clock to have a minimum low period of 1.3 μ s, use 390 kHz instead of 400kHz by writing 0x06200000 to the FREQUENCY register. With this setting, the SCL low period is greater than 1.3 μ s.

3.45 [228] RADIO: No interrupt is generated for SYNC event

This anomaly applies to IC Rev. Engineering C, build codes CKAA-CA0, QIAA-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

Interrupt Service Routine (ISR) for the SYNC event does not run.

Conditions

Always.

Consequences

ISR for the SYNC event does not run.

Workaround

Connect the SYNC event to an EGU task through a PPI channel. Handle the interrupt in the corresponding EGU ISR.

3.46 [233] NVMC: NVMC READYNEXT not generated

This anomaly applies to IC Rev. Engineering C, build codes CKAA-CA0, QIAA-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

When executing from NVM and performing an NVM operation, READYNEXT might not be asserted. If the program is waiting for READYNEXT, the program stops executing.

Conditions

When executing from NVM. Using READYNEXT when executing from RAM is not affected.

Consequences

READYNEXT should not be used when executing from NVM.

Workaround

Use READY instead. Using READY instead of READYNEXT has no penalty when executing from NVM.

3.47 [236] RADIO: Conversion formulas for RADIO energy related values incorrect in PS

This anomaly applies to IC Rev. Engineering C, build codes CKAA-CA0, QIAA-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

Conversion between hardware value and dBm in the Product Specification RADIO chapter is incorrect

Conditions

Always

Consequences

The calculated value is not correct

Workaround

Conversion between hardware value and dBm: $PRF[\text{dBm}] = ED_RSSIOFFS + VALHARDWARE$ Conversion between hardware value and 802.15.4 units (0-255): $PRF[802.15.4 \text{ units}] = \text{MIN}(ED_RSSISCALE \times VALHARDWARE, 255)$

3.48 [237] SAADC: TASKS_CALIBRATEOFFSET shall only be used before TASKS_START or after EVENTS_END

This anomaly applies to IC Rev. Engineering C, build codes CKAA-CA0, QIAA-CA0.

It was inherited from the previous IC revision [Engineering B](#).

Symptoms

Unexpected samples are written to RAM.

Conditions

TASKS_CALIBRATEOFFSET is triggered between TASKS_START and EVENTS_END.

Workaround

TASKS_CALIBRATEOFFSET shall be used only before TASKS_START or after EVENTS_END.

4 Fixed anomalies

The anomalies listed in this table are no longer present in the current chip version.

For a detailed description of the fixed anomalies, see the [Errata for revision Engineering B](#).

ID	Module	Description
94	USB	BUSSTATE register is not functional
186	POWER	High current consumption in System ON Idle, using High Voltage mode
189	SPIM	RX buffer error at 32 MHz operation

Table 2: Fixed anomalies